

3 Potential Infection Sources

3.1 Wet areas in Sterile Stores

Sinks or handwash basins should NOT be provided in sterile environments, such as sterile stock storage areas. Clinical handwash basins should be located external to such areas to avoid any cross-contamination risk.



Figure 8: no sinks or hand basins in sterile stock storage areas

Sinks or handwash basins, where required in Clean Utility or medication rooms, should be positioned to avoid any risk of contamination of sterile stock that may be stored in the room. The “Type B” handwash basin is recommended for this particular application.

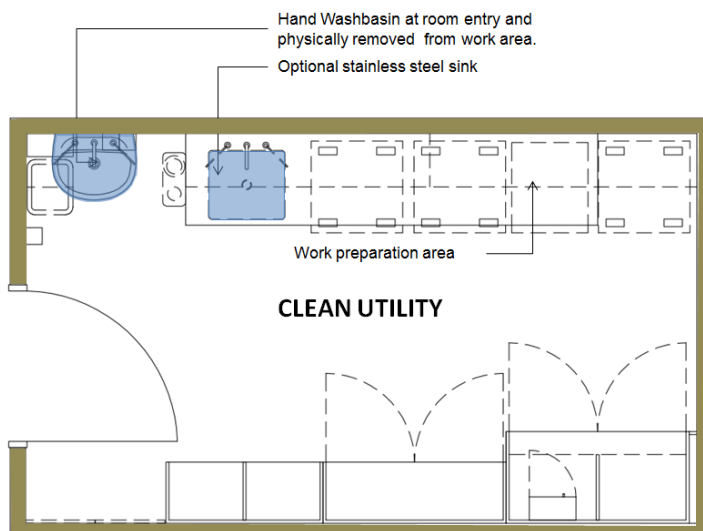


Figure 9: Typical Clean Utility/ Medication Room plan showing preferred location for basin and sink

3.2 Hydrotherapy Pools and Tanks

Infection prevention and control of hydrotherapy pools, birthing baths or tanks can be challenging, as micro-organisms are always present in the water during a treatment procedure.

Warm water temperatures, aeration and agitation of the water, along with the configuration of hydrotherapy tanks or pools create the ideal environment for the proliferation of bacteria. Surface finishes, equipment maintenance, and cleaning or disinfection is therefore paramount.

Potential transferal routes of infection include the accidental ingestion of water, sprays and aerosols, and direct contact with wounds or intact skin.

A written methodology statement describing proposed sanitation procedures and systems should be provided at an early stage of the design process. Based on the proposed strategy, equipment operation and instruction manuals can be produced by the contractor to assist the end user with required operational procedures.

Due to the size of hydrotherapy pools which precludes draining after patient use, stringent management practices are required to maintain constant water conditioning and disinfection. It is therefore recommended that a regular training program with regard to the proper use of the installed equipment is put in place by the facility operator.



Figure 10: Hydrotherapy pool

3.3 Ice Machines and Ice Production

Micro-organisms may be present in ice, ice storage chests and ice-making machines. The two main sources for micro-organisms are the potable water used for making ice, and the transferal of micro-organisms via the hands.

Microorganisms in ice can also contaminate clinical or medical specimens that require cold temperatures for transporting or holding.

Improper storage and improper handling of ice by staff and /or patients may result in ice-making machines or ice becoming contaminated. To avoid contamination, it is recommended that:

- The selection and installation of ice making machines is made to ensure a button control dispenses ice directly into a portable container.
- Direct hand contact of ice intended for human consumption is avoided or minimized.
- Ice scoops used for dispensing ice are made from a durable and impervious material and are regularly sterilized.

3 Potential Infection Sources



Figure 11: Benchtop dispensing ice making units preferred

Frequent cleaning and mild disinfection of portable ice chests and containers is recommended and should be part of operational procedures - while regular ice making machine maintenance is important for appropriate performance. Accordingly, appropriate policies and procedures based on operational and maintenance manuals should be adhered to and verified on a regular basis.



Figure12: Bulk/chest ice making units not recommended

3.4 Materials Management and Chutes

Materials Management

Material Management is a scientific technique of planning, organizing and controlling the flow of materials from initial acquisition, usage and ultimate disposal.

Within a healthcare environment, this can include, but is not limited to food distribution, clean and dirty linen distribution, medical product distribution and waste material distribution.

Good waste management practice requires minimizing exposure to all types of wastes. Movement of waste materials throughout a healthcare facility should be undertaken to avoid peak activity times such as meal times, visiting hours and change of staff shifts. In addition, any clinical or related waste should not be moved through public areas or general staff corridors.

Future trends will quite likely see the introduction of greater mechanization to all types of material management, particularly waste materials where potential infection risks to patients and operators can be minimized. A safer solution to all types of waste material handling, whether, hazardous, infectious, or general (non-hazardous) wastes should result.

It is therefore anticipated that the use of Automated Guided Vehicles (AGVs) will become more prevalent in coming years. An AGV is a mobile robot that uses vision, magnets or lasers; alternatively markers or wires in the floor surface to automatically navigate and distribute materials within a healthcare facility environment.

3 Potential Infection Sources

Automated guided vehicles (AGVs) increase the efficiency of waste material handling, reduce the risk of infections, and may assist with reducing long term operating costs associated with waste material disposal.

Capital cost outlays, when measured against the ongoing operating costs for the life of a healthcare facility, may result in a greater acceptance of the AGV methodology.

Whether for immediate or future incorporation, AGVs should ideally be given consideration at the early planning stages of a healthcare facility and included in the overall IPC strategy.



Figure13: Typical AGV with a supply trolley

Waste Chutes

Chutes are vertical hollow tubes, generally steel lined that provide for the movement of waste materials from waste generating areas to a centralized collection point.

Chutes to move clinical and related wastes are not permitted because of the risk of spillage and unnecessary exposure to infection.

Soiled linen and general waste chutes are not recommended in healthcare facilities as chutes will increase the risk of transmitting airborne infections. They should only be considered as a last resort when planning a healthcare facility.



Figure 14: Linen and Waste chutes are not recommended



The International Health Facility Guidelines recommends the use of HFBS “Health Facility Briefing System” to edit all room data sheet information for your project.

HFBS provides edit access to all iHFG standard rooms, and departments, and more than 100 custom report templates.

HFBS Health Facility Briefing System



Briefing Module

The Health Facility Briefing System (HFBS) has numerous modules available via annual subscription. It suits healthcare Architects, Medical Planners, Equipment Planners Project Managers and Health Authorities.

Use the HFBS Briefing Module to quickly drag in health facility departments or pre-configured room templates from the iHFG standard, edit the room features such as finishes, furniture, fittings, fixtures, medical equipment, engineering services. The system can print or download as PDF more than 100 custom reports including room data sheets, schedules, and more...

To learn more about the HFBS web-based Healthcare Briefing and Design Software and to obtain editable versions of the “Standard Components” including Room Data Sheets (RDS) and Room Layout Sheets (RLS) offered on the iHFG website, signup for HFBS using the link below.

Get Started Now:
hfbs.healthdesign.com.au

- ✓ iHFG Room Data Sheets and Departments are instantly editable in the HFBS software available online.
- ✓ You can access hundreds of report templates to print your iHFG room data in HFBS.
- ✓ HFBS has a onetime free 3 day trial available to all new users.

Get Started Now:
hfbs.healthdesign.com.au



HFBS

Health Facility Briefing System

hfbsinfo.com | techsupport@healthdesign.com.au